City of Ph	hoenix
Certificate of Inspection and Conditional	l Permit
to Operate Elevator	
This Certifies that the equipment described below has been	
inspected and may be operated within the limitations stated*	EXPIRES
	Month Year
Embassy Suites Phx North	9 2013
2577 W GREENWAY RD	serial #: 1024#4K
PHOENIX, AZ 85023-4222	MFG: MATOT MANUFACTURING
	Kind: DUMBWAITERS
*Do not Exceed	
This Certificate Must Be Posted In or Near Designated Equipm	500 lbs 0 fpm 0 Pass
	Elevator Inspections Section
	(602)262-7853
Cut here and post the abov	ve certificate
REPORT: DSRP0053 STANDARD ELEVATOR EQUIPMEN	T INSPECTION REPORT Run Date: 29-DEC-12
Serial: 1024#4K	Type: MAT-0-ELEC
Customer No: 0008550788	Permit: 99016290
JERRY MOYNIHAN	Bld Name: Embassy Suites Phx North
2577 W. GREENWAY ROAD	Address: 2577 W GREENWAY RD
PHOENIX, AZ 85023	Service Co: OTIS ELEVATOR
Inspector: 417	QSect: Q34-23
Inspection Date: 10-SEP-12 Nex	t Inspection: 01-SEP-13
Installation Date: 29-JAN-87 1	yr Test Date:
	yr Test Date:
	SME Code Date:
Key Phone:	


Comments:

Unit is Red Tagged. Dumbwaiter below first floor level. CONTINUES OOS. 4/26/00 17-MAR-04,04-JUN-08--#411

Violations and Corrections:

10-SEP-12	00S	Out of service, permit and inspection required before use.
07-DEC-11	OOS	Out of service, permit and inspection required before use.
03-JAN-11	OOS	Out of service, permit and inspection required before use.
17-MAR-04	1000.3	Installation placed out of service. A permit is required before
		equipment can be returned to service, it will be subject to all
		routine and periodic inspections and tests.

City of Phoenix				
Certificate of Inspecti to Operate Elevator	on and Conditional Permit			
This Certifies that the equipment				
inspected and may be operated with	In the limitations stated.	EXPIRES		
		Month Year		
Embassy Suites Phx	North	3 2013		
2577 W GREENWAY RD		Serial #: 1022#2		
PHOENIX, AZ 85023-	4222	MFG: OTIS ELEVATOR		
		Kind: 2-STOP PASSENGER HYDRAULIC		
		*Do not Exceed		
This Certificate Must Be Posted In	or Near Designated Equipment	2500 lbs 115 fpm 16 Pass		
		Elevator Inspections Section		
		(602)262-7853		
	Cut here and post the above certificat ARD ELEVATOR EQUIPMENT INSPECT:			
Serial: 1022#2		Type: OTI-2-HYDRO		
Customer No: 0008550788		Permit: 99016288		
JERRY MOYNIHAN	Bld N	ame: Embassy Suites Phx North		
2577 W. GREENWAY ROAD		ess: 2577 W GREENWAY RD		
PHOENIX, AZ 85023	Service	Co: OTIS ELEVATOR		
Inspector: 417		ect: Q34-23		
Inspection Date: 10-SEP-12				
Installation Date: 29-JAN-87		ate: 11-JUL-12		
Fire Recall Date:	5 yr Test Da	ate:		
Service Status: In Servic	e ASME Code Da	ate: 01-JAN-78		
Key Phone:				
Comments:				
BLDGMAIN LOBBY				
Violations and Corrections:				
10-SEP-12 111.12A		oistway or car doors shall be opened more than 4 inches from		
	(BETWEEN FLOORS RESTRICTOR MI	SSING)SECOND NOTICE		
10-SEP-12 *	Please repair listed correcti	on notices.		
	Comments: SECURE LOOSE HANDRA NOTICE	ILS IN THE CAB ENCLOSURESECOND		

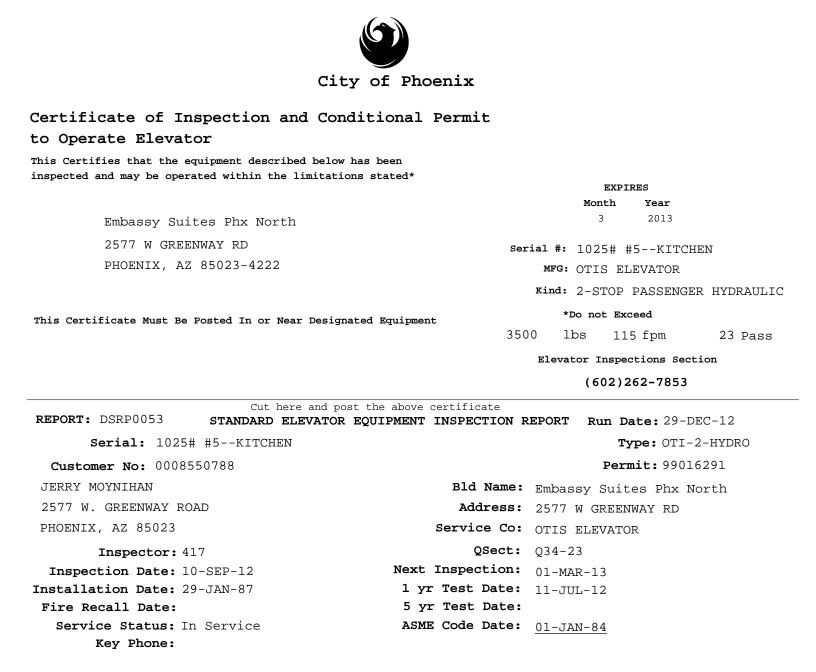


Comments:

Violations and Corrections:

10-SEP-12	111.12A	Repair door restrictor, the hoistway or car doors shall be arranged that they may not be opened more than 4 inches from
		inside the car.
		(RESTRICTOR NOT OPERATIONAL BETWEEN LANDINGS)
03-JAN-11	A17.3-2.7.4	When a car is outside the unlocking zone, the hoistway doors or
		car doors shall be so arranged that the hoistway doors or car
		doors cannot be opened more than 4 in. (102 mm) from inside the
		car.

Complete above item by: 01-JAN-2012

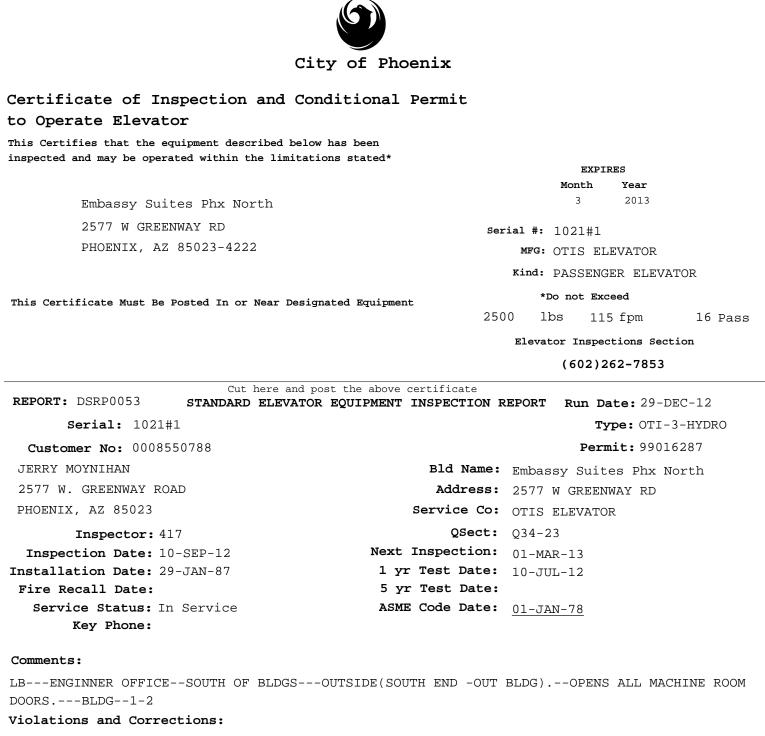

10-SEP-12	#	Violations listed shall be corrected within thirty days of receipt of notification
		(CHECK BATTERY LOWERING UNIT FOR ELEVATORBATTERY APPEARS TO BE DISCHARGED)
		SECOND NOTICE
10-SEP-12	8.6.1.6.5	Class "ABC" fire extinguishers shall be provided in electrical machinery and control spaces and shall be located convenient to the access door.
		(PROVIDE FIRE EXTINGUSHER)SECOND NOTICE
10-SEP-12	2.27.1.1.3	Repair the audible signaling device and illumination of the alarm




Embassy Suites Phx North 2577 W GREENWAY RD PHOENIX, AZ 85023-4222

Serial #: 1021#1

Run Date: 29-DEC-12

switch or visual identification, it shall function at least 1 h when normal power is removed.

ALARM BELL IS NOT OPERATIONAL) ---- SECOND NOTICE

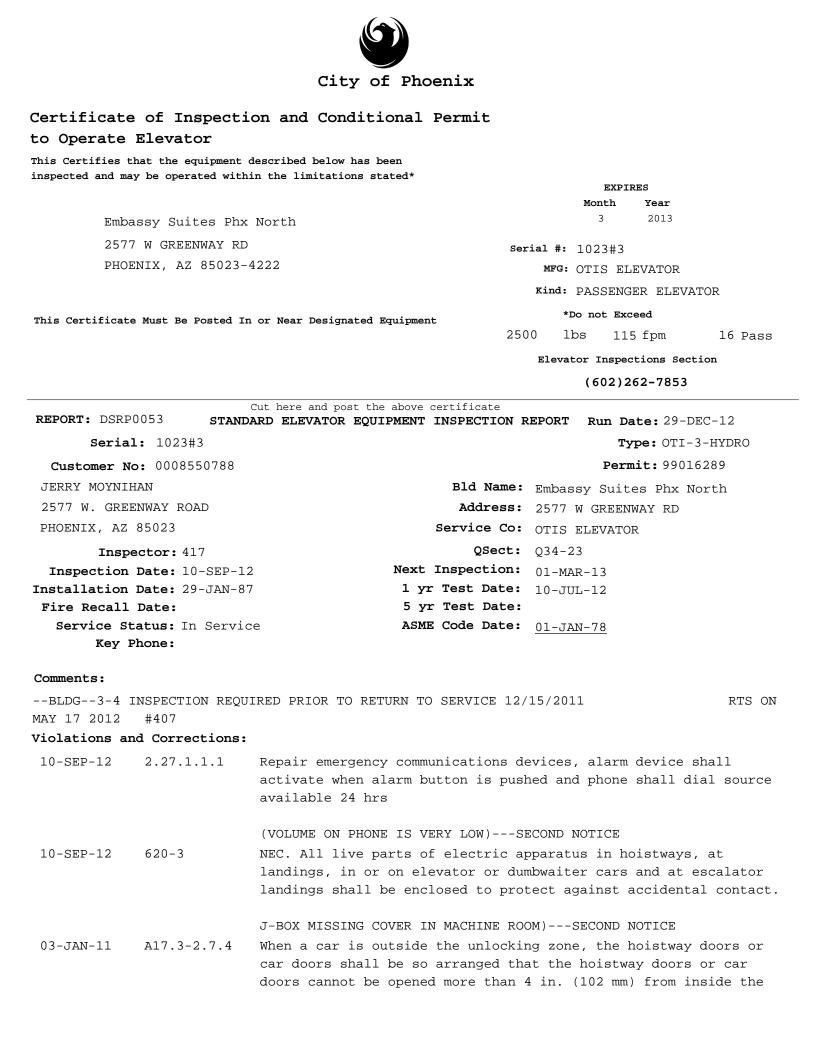



Embassy Suites Phx North 2577 W GREENWAY RD PHOENIX, AZ 85023-4222


Serial #: 1023#3

Run Date: 29-DEC-12

car.

Complete above item by: 01-JAN-2012

- 03-JAN-11 8.6.1.6.5 Class "ABC" fire extinguishers shall be provided in electrical machinery and control spaces and shall be located convenient to the access door.
- 03-JAN-11 620-3 NEC. All live parts of electric apparatus in hoistways, at landings, in or on elevator or dumbwaiter cars and at escalator landings shall be enclosed to protect against accidental contact. ELECTRICAL J-BOX MISSING COVER

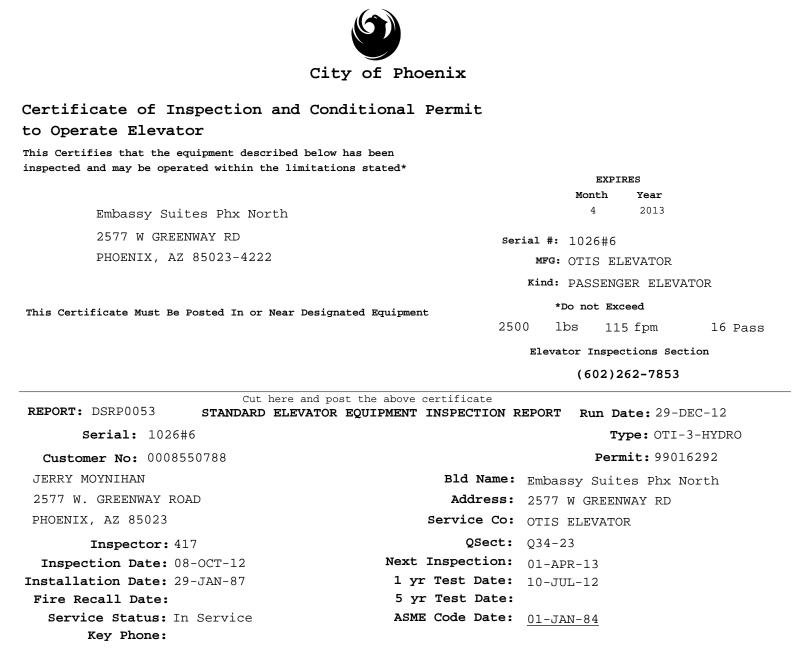

Comments:

BLDG#5-6-7

Violations and Corrections:

08-OCT-12	111.12A	Repair door restrictor, the hoistway or car doors shall be arranged that they may not be opened more than 4 inches from inside the car.
08-OCT-12	2.2.5	Repair Pit lighting. The lighting shall provide an illumination of not less than 1001x, (10)ftc at the pit floor and at a pit platform when provided
08-OCT-12	8.6.1.6.5	Class "ABC" fire extinguishers shall be provided in electrical machinery and control spaces and shall be located convenient to the access door.
03-JAN-11	A17.3-2.7.4	When a car is outside the unlocking zone, the hoistway doors or car doors shall be so arranged that the hoistway doors or car doors cannot be opened more than 4 in. (102 mm) from inside the car.



Embassy Suites Phx North 2577 W GREENWAY RD PHOENIX, AZ 85023-4222

Serial #: 1026#6

Run Date: 29-DEC-12

Complete above item by: 01-JAN-2012